

Monitoring Data Record

Project Title: R-2000G (I-540) COE Action ID: 199920387
Stream Name: UT Neuse River (Site 10) DWQ Number: 030114
City, County and other Location Information: I-540, Wake County (Sta.460+53 -L- to 459+80 -L- RT.)
Date Construction Completed: April 2005 Monitoring Year: (5) of 5
Ecoregion: _____ 8 digit HUC unit 03020201
USGS Quad Name and Coordinates: _____

Rosgen Classification: _____

Length of Project: 312' Urban or Rural: Urban Watershed Size: _____
Monitoring DATA collected by: M. Green Date: 6/15/11
Applicant Information:

Name: NCDOT Roadside Environmental Unit
Address: 1425 Rock Quarry Road Raleigh, NC 27610
Telephone Number: (919) 861-3772 Email address: mlgreen@ncdot.gov

Consultant Information:

Name: _____
Address: _____
Telephone Number: _____ Email address: _____

Project Status: Complete

Monitoring Level required by COE and DWQ (404 permit/ 401 Cert.): Level (1) 2 3

Monitoring Level 1 requires completion of *Section 1, Section 2 and Section 3*

Permit States: NCDOT shall perform the following components of Level I monitoring twice each year for the 5 year monitoring period (summer and winter): Reference photos, plant survival, and visual inspection of channel stability. If less than two bankfull events occur during the first 5 years, NCDOT shall continue monitoring until the second bankfull event is documented. The bankfull events must occur during separate monitoring years. In the event that the required bankfull events do not occur during the 5-year monitoring period, the USACE, in consultation with resource agencies, may determine that further monitoring is not required.

Section 1. PHOTO REFERENCE SITES

(Monitoring at all levels must complete this section)

Total number of reference photo locations at this site:

A total of 9 photos were taken from 4 photo point locations.

Dates reference photos have been taken at this site: 3/14/07, 7/16/07, 3/14/08, 6/11/08, 1/7/09, 7/6/09, 1/19/10, 7/28/10, 1/13/11, 6/15/11

Individual from whom additional photos can be obtained (name, address, phone): _____

Other Information relative to site photo reference: A site map is included with this report showing the photo point locations.

If required to complete Level 3 monitoring only stop here; otherwise, complete section 2.

Section 2. PLANT SURVIVAL

Attach plan sheet indicating reference photos.

Identify specific problem areas (missing, stressed, damaged or dead plantings):

Estimated causes, and proposed/required remedial action:_____

ADDITIONAL COMMENTS: Streambank reforestation was completed on 2/27/07. Streambank reforestation included black willow and silky dogwood live stakes and tulip poplar, sycamore, green ash, willow oak, and water oak bareroot seedlings. The planted live stakes and bareroot seedlings are surviving. Other vegetation noted on site included red maple, sweetgum, alder, lespedeza, cattails, sedge, sumac, stinkweed, fennel, *Juncus* sp., pine, *Baccharis* sp., and various grasses. NCDOT proposes to discontinue plant survival monitoring at the UT Neuse River stream relocation.

If required to complete Level 1 and Level 2 monitoring only stop here; otherwise, complete section 3.

Section 3. CHANNEL STABILITY

Visual Inspection: The entire stream project as well as each in-stream structure and bank stabilization/revetment structure must be evaluated and problems addressed.

Report on the visual inspection of channel stability. Physical measurements of channel stability/morphology will not be required. Include a discussion of any deviations from as-built and an evaluation of the significance of these deviations and whether they are indicative of a stabilizing or destabilizing situation.

The UT Neuse River stream relocation is stabilized, except for, two localized areas for the Year 5 Summer evaluation. The area of bank scouring along the left bank at Sta. 1+50 –RPC- and the headcut at Sta. 1+00 –RPC- noted previously have little or no change since the last evaluation. By visual inspection throughout the 5-year monitoring period, NCDOT documented 5 bankfull events occurring during March 2007, March 2008, June 2008, January 2009, and January 2010. NCDOT proposes to discontinue channel stability monitoring at the UT Neuse River stream relocation.

Date 6/15/11	Station 1+50 –RPC (just downstream of PP#1) additional photo attached	Station 1+00 – RPC- (b/t PP#3 & PP #4) additional photo attached	Station Number	Station Number	Station Number
Structure Type					
Is water piping through or around structure?					
Head cut or down cut present?		Headcut			
Bank or scour erosion present?	Bank scouring along left bank				
Other problems noted?					

Section 4. DEBIT LEDGER

The entire UT Neuse River stream mitigation site was used for the R-2000G project to compensate for unavoidable stream impacts.

UT Neuse River



Photo Point #1 (Upstream)



Photo Point #1 (Upstream Looking at Culvert)



Photo Point #1 (Downstream)



Photo Point #2 (Upstream)

Year 5 Summer – June 2011



Photo Point #2 (Downstream)

UT Neuse River



Photo Point #3 (Upstream)



Photo Point #3 (Downstream)



Photo Point #4 (Upstream)



Photo Point #4 (Downstream)



Headcut at Sta. 1+00 -RPC-
Year 5 Summer – June 2011




Bank scouring at Sta. 1+50 -RPC-

UT Neuse River



Overview Photo

Year 5 Summer – June 2011

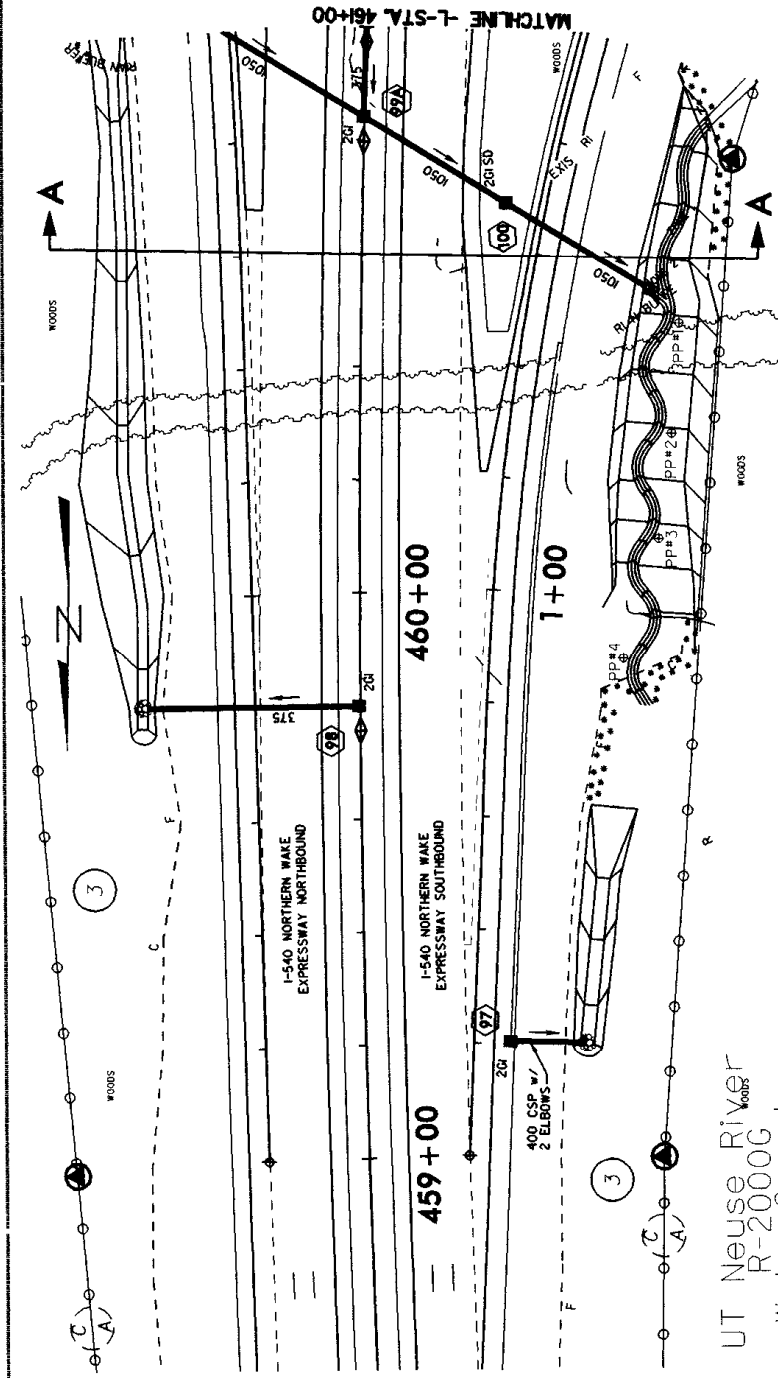

UT Neuse River
R-2000G
Wake County



⊕ Photo Point Locations

N.C. DEPT. OF TRANSPORTATION
DIVISION OF HIGHWAYS

WAKE COUNTY

PROJECT: 8U401712 (R-2000G)
I-540 NORTHERN WAKE EXPRESSWAY

SHEET 09 OF 16